



BLUE BIRD

SERVICE MEMORANDUM

NO. SM1313

MEMO TO: All Blue Bird Dealers

SUBJECT: Malfunction Indicator Lamp and/or Engine Warning Lamp “ON” after cold starting engine.

MODEL YEAR(S): 2014

MODEL(S) AFFECTED: Vision and All American with 2013–Emission Diesel Engines

Cummins has released software calibration update improvements to reduce occurrence of engine malfunction indicator lamp and check engine lamp “ON” after cold starting the engine. Fault code 4252 (Engine Wait to Start Lamp–Condition Exists) becomes active. Primary cause of condition: Operator/driver cold starting engine without waiting for the “Wait to start” lamp to come “ON” and go “OFF”.

If your bus has an engine with a Cummins manufacture date earlier than listed below, a software calibration revision is available. Please contact your local Cummins repair facility.

Cummins Engine Build Dates:

ISB6.7 CM2350 – July 11, 2013

ISL9 CM2350 – June 28, 2013

Cummins Engine Calibrations Must Be Equal To Or Higher Than Revisions Listed:

ISB6.7

<u>ECM Code</u>
<u>DT90009.18</u>
<u>DT90002.19</u>
<u>DT90025.11</u>
<u>DT90004.19</u>
<u>DT90006.19</u>
<u>DT90034.11</u>

ISL9

<u>ECM Code</u>
<u>EB90021.17</u>
<u>EB90019.17</u>
<u>EB90017.17</u>

BLUE BIRD BODY COMPANY

P.O. Box 937 – 402 Blue Bird Blvd – Fort Valley, Georgia – (478) 825-2021